

User Manual

English

Portable Hardness Tester



dmeq

QH5 Models D / G / M

www.demeq.com

QH5 User Manual

Portable Hardness Testers

P/N: QHD 501 – ENG – Rev 3 – 2012

Index

Chapter 1		First steps	
1.1	Know the QH5		1
	1.1.1	Front panel	2
	1.1.2	Connectors	2
1.2	Install or replace batteries		3
1.3	Connecting the impact device		5
1.4	Using the impact device		6
	1.4.1	Loading the impact body	6
	1.4.2	Release and measure	6
1.5	The "Q" key		7
1.6	Display illumination and contrast		7
	1.6.1	Display backlight illumination	7
	1.6.2	Display contrast	8
1.7	Locking and unlocking the keypad		8
Chapter 2		Measuring with the QH5	
2.1	Numerical measure screen (Normal)		10
	2.1.1	Screen mode-1 (Datalogger)	10
	2.1.2	Screen mode-2 (Material)	11
	2.1.3	Screen mode-3 (Statistics)	11
2.2	Keys in numerical measure modes		12
2.3	Graphic measure screen (Histogram)		14
2.4	Keys in the graphic measure screen mode		15
2.5	Set impact device angle		16
2.6	Select material and hardness unit		17
Chapter 3		Menu system and editing	
3.1	Instructions on using the menu system		19
	3.1.1	Text editor	20
3.2	Main menu		22
	3.2.1	Change hardness unit	22

	3.2.2	Alarm settings	23
	3.2.3	Set histogram range	24
	3.2.4	Select language	24
	3.2.5	Unit information	25
3.3		General configuration options	25
	3.3.1	Set time and date	26
	3.3.2	Set time and date format	26
	3.3.3	Set keypad sensitivity	26
	3.3.4	Set auto-off time	28
	3.3.5	Adjust display contrast	28
	3.3.6	Beep activation	29
	3.3.7	Introduction screen	29
	3.3.8	Owner information	29
	3.3.9	Lock configuration options	31
	3.3.10	Model upgrade licenses	32
	3.3.11	Return to factory default settings	33
3.4		Measuring configuration options (Hardness)	34
	3.4.1	Set impact device angle	34
	3.4.2	Select material	35
	3.4.3	The "Plus" key	35
	3.4.4	Set group (N) number	36
	3.4.5	Select measure mode	37
	3.4.6	Create custom or user units	37
	3.4.7	Select impact device type	41
	3.4.8	Set alarm for impact device tip	42
	3.4.9	Return to factory default settings	42

Chapter 4 Using the Datalogger

4.1	How data is organized	43
4.2	Memory menu	44
4.3	Creating a file	44
4.4	Actions over single files	45
4.4.1	View data in a single file	46
4.4.2	The "Q" key in a grid	47
4.4.3	The "Q" key in a histogram	48
4.4.2	Send data from a single file	48
4.4.3	Rename a file	49
4.4.4	View file size	49
4.5	Actions over all files	49
4.5.1	Send all files	49
4.5.2	Erase all files	49
4.6	Quick memory menu (Mem key)	50
4.7	Connecting to PC with DataCenter	51
4.8	Datalogger configuration	52
4.8.1	Configure communications	52
4.8.2	Capture modes	54
4.8.3	Advanced configuration	54

Appendix

Tips on how to measure correctly

Technical specifications

Additional information

Unit maintenance
 QH5 accessories
 Error messages
 Our website: www.demeq.com
 Technical Support

Thank you choosing dmq

And thank you for purchasing a QH5 rebound hardness tester.

Company Statement

At dmq we develop, manufacture and distribute software and quality control instruments offering innovation and solutions that come as a direct result of listening to your needs as a user. We apply some of the latest technology available in the industry to build instruments that are robust, precise, and easy to operate.

We are convinced that our products would not be complete without permanent technical and after sales support. So in addition to a great product we offer:

- Quick answers to your inquiries.
- Unlimited access to technical information as well as application notes.
- Special offers for registered customers.
- Firmware and software upgrades at no charge.
- Attention to your inquiries and suggestions.

We hope that the QH5 will meet and exceed your application needs.

General information

Models included in this manual

The information included in this manual applies to all QH5 series portable hardness testers including models D, G and M.

Registered trademarks

dmq is a registered trademark of demeq S.R.L and its affiliate companies.

Important notice

The information contained in this manual is intended to educate users on the operation of the QH5 impact hardness testers. Failure to read and understand this manual can lead to measurement errors. Decisions based on measurements and or results that are erroneous can lead to property damage, personal injury or even death. Demeq S.R.L assumes no responsibility as a result of the improper use of our instruments.

Applicable standards

- ASTM A956

User training

Correct use of an impact hardness tester requires that you take all of the following into consideration:

- Select the instrument as well as the impact device that is best suited for your application.
- Know the specific requirements for the test you will be conducting.
- Make sure that the person operating the unit has been trained on its use.

This manual provides all of the information needed to configure and operate the QH5 hardness tester. However there are additional factors that can affect tests done with this instrument. Specific information on those factors is outside the scope of this manual. When in doubt you should always seek expert advice or refer to specific textbooks on portable hardness testing. Additional information can also be found on the internet and through local government agencies as well as in technical institutes.

Measuring Principle

All QH5 units operate on the Leeb impact rebound method where the ratio between the impact and rebound velocities of the impact body that is released on the test piece, are measured to establish a Leeb hardness value. The step by step process is represented in figure 1 as follows: 1, the impact body is released and travels inside the impact device; 2, the impact body tip hits the test piece; 3, the impact produces a rebound.

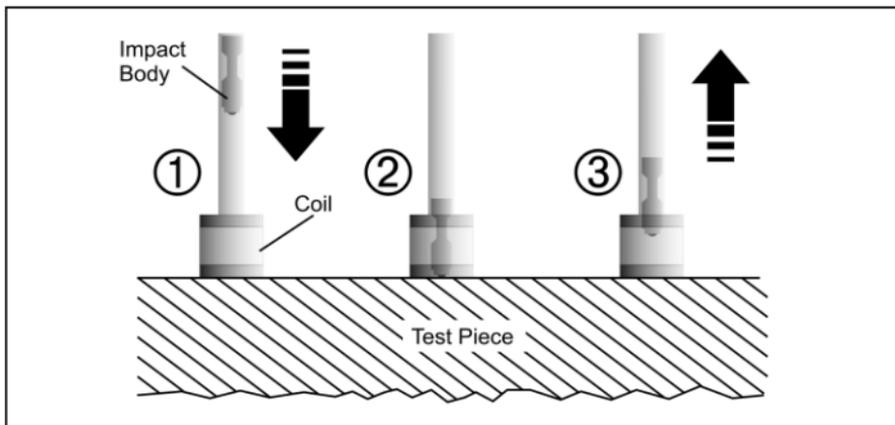


Figure 1: Representation of the Leeb rebound method

The measured Leeb value (HL) represents a direct hardness value that is converted to other hardness units such as Brinell, Vickers, Rockwell and Shore. Both the HL value and another selected hardness unit are displayed on the unit screen simultaneously.

Selecting the impact device type

There are a number of available impact devices and each one of them is different and ideal for specific applications. In this section general information, measuring ranges and recommended applications are briefly explained for each impact device type.

In figure 2 a representation of the physical aspect of each one of the impact device types available for the QH5 is shown.

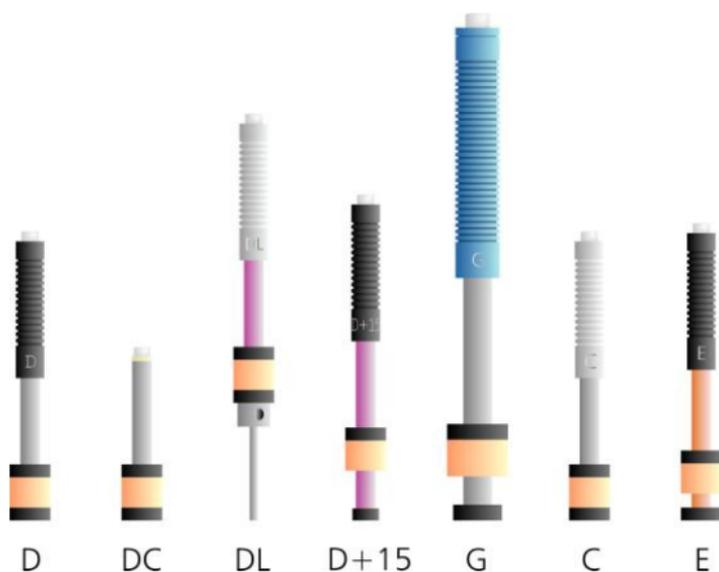


Figure 2: Representation of Impact device types for QH5 units

Impact device type D

This is the standard device in impact hardness testing because it measures in all of the units and materials covered with the QH5. The type D impact device covers the widest range of applications.

Impact device type DC

This device type, just like impact device type D, can also measure in all units and materials but features a much shorter body (50mm) making ideal for measurements in hard to reach places that cannot be accessed with a type D device. Unlike impact device D that is spring loaded, device DC is loaded manually

Impact device type DL

The long and thin tip on impact device type DL allows access to very narrow areas that cannot be measured with any other impact device. This device measures steel only.

Impact device type G

This impact device type includes a large hardness tip that is 5mm in diameter and it also releases the highest impact energy at 90 N*mm allowing its use over rough surfaces such as those in founded and forged pieces and in grey cast iron.

Impact device type C

On device type C the impact tip produces the less amount of energy when compared to other device types (up to 25% less than device type D) therefore becoming the best choice for measuring treated surfaces on steel parts and for measuring smaller pieces. The lower release energy level produces the smaller test piece indentation. This device measures steel only.

Impact device type E

Impact device E uses a synthetic diamond tip (all other impact device types use tungsten carbide tips). The diamond tip allows it to measure harder test pieces such as those made out of template steel. This device type measures steel only and extends the Vickers range to 1211HV (device type D measures up to 940HV).

The table below shows detailed technical information on each impact device type.

Impact devices comparison table

Parameter (Unit)	Impact device type					
	D/DC	D+15	DL	C	G	E
General characteristics						
Length (mm)	147/86	162	202	141	254	155
Diameter (mm)	20	20	20	20	20	20
Weight (g)	75/50	80	100	75	250	80
Max Hardness (HV)	940	940	950	1000	650	1200
Impact device tip						
Diameter (mm)	3	3	2.78	3	5	3
Hardness (HV)	1600					5000
Material	Tungsten carbide					Diamond

Impact devices comparison table (Continued)

Impact body						
Energy (N*mm)	11	11	11	3	90	11
Mass (g)	5.5	7.8	7.3	3	20	5.5
Surface test piece requirements						
Rugosity ISO	N7	N7	N7	N5	N9	N7
Rugos. RT (μm)	10	10	10	2.5	30	10
Rugos. RA (μm)	2	2	2	0.4	7	2
Minimum test piece weight (Kg)						
Stand alone	5	5	5	1.5	15	5
With solid support	2	2	2	0.5	5	2
Coupled with paste	0.1	0.1	0.1	0.02	0.5	0.1
Minimum test piece thickness (mm)						
Coupled	3	3	3	1	10	3
Surface thickness	0.8	0.8	0.8	0.2	—	0.8
Test piece impact indentation						
On parts up to 300HV						
Diameter (mm)	0.54		0.38		1.03	0.54
Depth (μm)	24		12		53	24
On parts up to 600HV						
Diameter (mm)	0.45		0.32		0.90	0.45
Depth (μm)	17		8		41	17
On parts up to 900HV						
Diameter (mm)	0.35		0.30		—	0.35
Depth (μm)	10		7		—	10

Impact device components

This section provides an overview of basic impact device components.

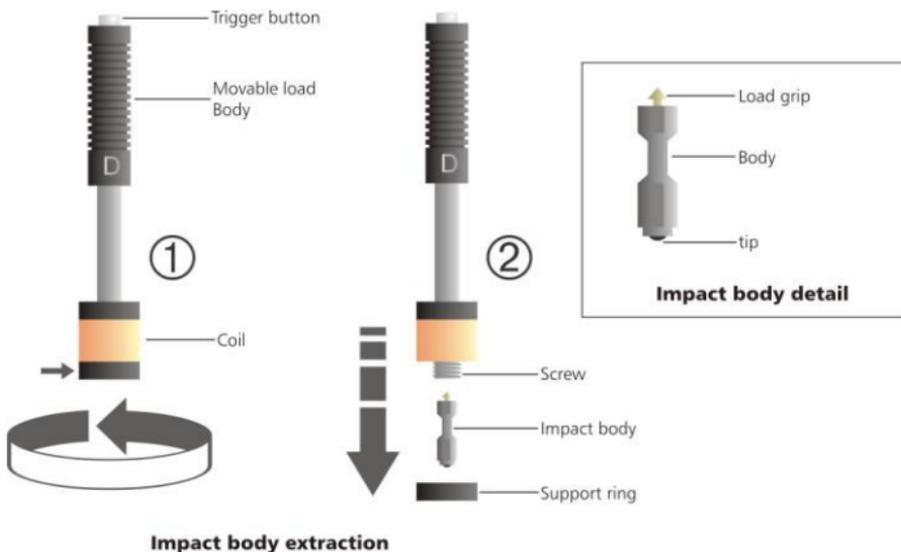


Figure 3: Impact device components

Figure 3 is a representation of the most important parts that make up an impact device and the procedure used to remove the impact device tip. Over time and depending on the number of measurements that you make, the impact tip located on the impact device body must be replaced. In order to do this turn the support ring clockwise (see figure 3-1) until the ring is released and the impact body falls off (figure 3-2). Make sure you catch the impact body or that you work over a soft surface where the impact body can fall on without being damaged. Remove and replace the impact tip making sure everything is perfectly clean and repeat this procedure to re-assemble the impact device.

Important: Safety information

All QH5 series portable hardness testers are for industrial use only and cannot be used in medical applications. The QH5 operates on two AA size batteries. We strongly recommend that you use only top brand name alkaline batteries.

Disposal of your QH5 and its components must be done in compliance with all applicable regulations.

About the Software

Because of its complexity level, software is never really completely error free. For this reason in software controlled instruments always make sure that the operations required for your application are in correct working order.

Warranty

Demeq S.R.L provides a limited warranty for a period of 2 (two) years on electronic units and for 6 (six) months on transducers from the date of purchase and may be extended for up to 5 years.

Every instrument undergoes thorough testing during manufacturing as well as before shipping. In the event warranty service where to become necessary, demeq S.R.L and or your local distributor or representative will make a reasonable effort to replace your defective unit with another new or used unit, while your instrument undergoes warranty repair.

1 First steps

1.1 Know the QH5

1.1.1 Front panel

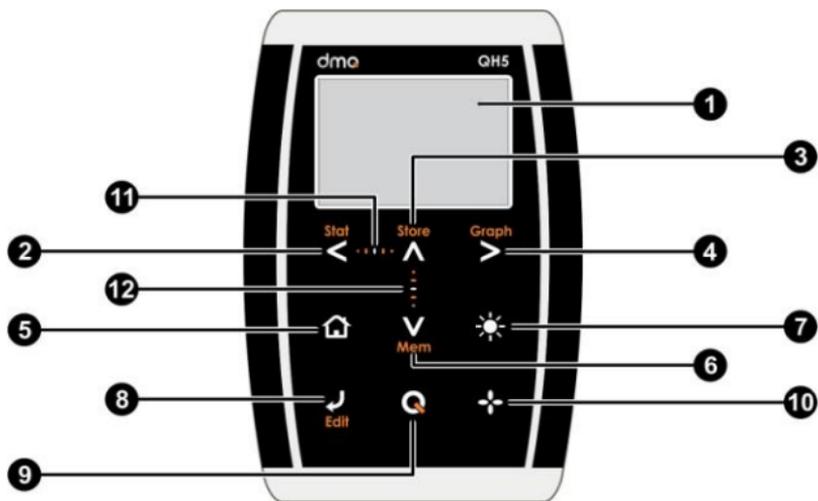


Figure 1.1: Front of the unit

1. Graphic LCD display with LED backlight illumination
2. Move Left key / View partial statistics (Stat)
3. Move Up key / Manually store a value (Store)
4. Move Right key / Switch to graphical measure mode screen (Graph)
5. Menu key / Enter and exit measure screen / Exit and return to menus (Home)

6. Move Down key / Quick access to memory menu screen options (Mem)
7. Change backlight illumination key (On, Off, Auto)
8. Enter key / Edit values on the measure screen (Edit)
9. The **Q** key: Power On and Shutdown (touch and hold for 2 seconds) / Make quick and short touches to activate special features
10. The **+** key: Direct measure screen access from any menu screens / User selectable functions
11. Horizontal scrolling center point (lock and unlock keypad on measure screen)
12. Vertical scrolling center point (adjust LCD contrast)

1.1.2 Connectors

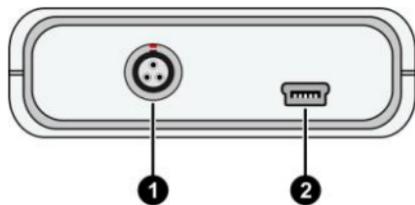


Figure 1.2: Unit connectors

1. Impact device connector type Lemo 0B
2. USB mini connector to connect to PC using a USB cable

1.2 Install or replace batteries

The QH5 is powered by 2 (two) AA batteries that are placed in the battery compartment located in the back of the unit. To gain access to the battery compartment slide the cover as shown in figure 1.3-1 and gently push the extraction ribbon upward and slightly towards the right to release the batteries (figure 1.3-2).

When you install new batteries, first insert the positive end of each battery so that it coincides with the positive pole inside the battery compartment as you see in figure 1.4-1.

Always leave the extraction ribbon underneath the batteries.

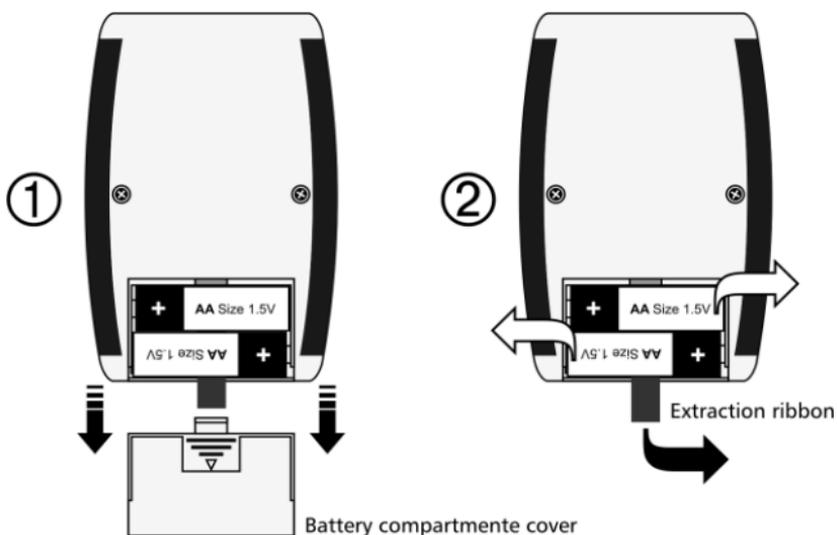


Figure 1.3: Removing batteries


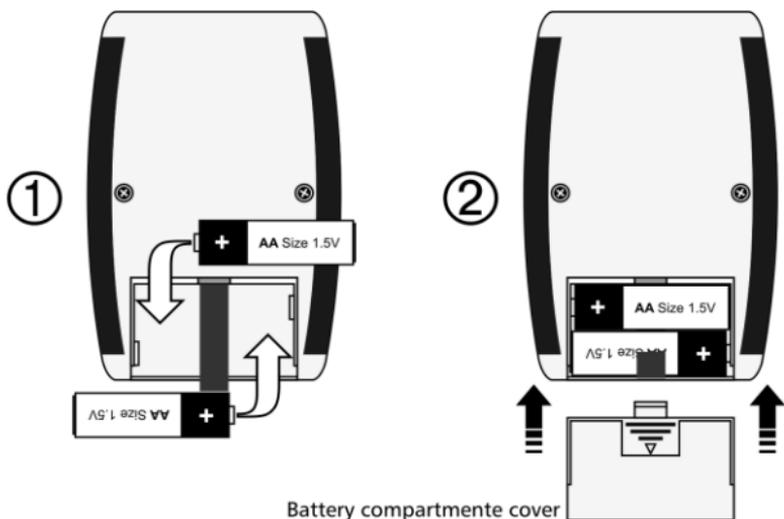


Figure 1.4: Replace / Insert batteries

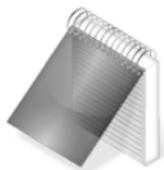

Notes

Always use new alkaline top brand batteries for extended battery life.

Do not mix new and old batteries. Always replace both batteries.

Rechargeable batteries type NiMH can be used but will result in less time of continuous operation.




Important

Do not remove batteries while the unit is powered as this may affect the Datalogger (See *Appendix: "Additional information, Error Messages"*)

1.3 Connecting the impact device

The QH5 uses a type Lemo 0B 3-pin connector located on top of the unit. All dmq impact devices are provided with Cal-Tag technology allowing you to easily switch or replace impact devices with no need to calibrate the unit. Universal non-brand impact devices can also be used as long as they have the same connector, but dmq does not guarantee their performance.

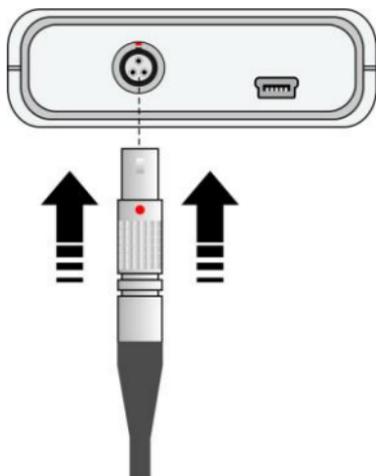

To connect the impact device simply align the red dot on the male connector with the red dot on the female connector located on the unit and press gently until connected (see figure 1.5)

To release the impact device hold the knurled section on the male connector and gently pull out.

Never remove the connector using the cable.

Figure 1.5: Connecting the impact device

1.4 Using the impact device

The procedure explained herein is applicable to all impact device types except for impact device type DC as it does not use a spring loading mechanism.

1.4.1 Loading the impact device

Place the impact device over the surface you want to measure and load by gently pushing the moving body of the impact device in the same direction as the test piece surface. Keep pushing the moving body until you reach the bottom limit and then bring the moving body back to its initial position.

The impact device is now loaded and ready to be used.

1.4.2 Release and measure

Once the impact device has been loaded use one hand to firmly hold the bottom of the impact device (the part that touches the surface you want to measure) against the surface and use your other hand to press the release button located on top of the impact device.

After pressing the button, the impact tip will hit the test piece surface and a hardness value will immediately be displayed.

Repeat this same procedure for each measurement.



Important

The Leeb method for hardness testing has requirements and limitations that must be considered in order to obtain reliable and accurate measurements (See *Appendix: "Tips on how to measure correctly"*)

1.5 The “Q” key

The  have three functions:

1. When the unit is off, touch  for 2 seconds to power on the unit.
2. When the unit is on, touch  for 2 seconds to shutdown the unit.
3. With the unit on, making short touches to the  will activate special functions described in each chapter of this manual.

1.6 Display backlight illumination and contrast

Backlight illumination and contrast options can be changed from any screen in the unit.

1.6.1. Display backlight illumination

Touch  to change the backlight illumination.


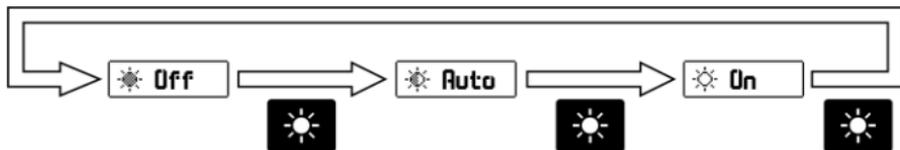


Figure 1.6: Backlight illumination options

1.6.1. Display contrast

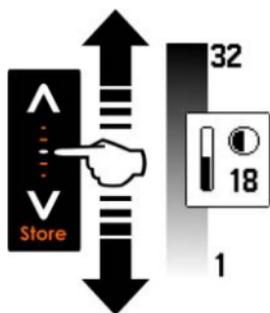

The display contrast on all dmq units is digital. Touch the white dot located in the center of the vertical scrolling bar between the **▲** - **▼** keys and a contrast window will open. Move your finger towards the top and or bottom of the dotted line to adjust the contrast on your display.

Figure 1.7: Display contrast adjustment

1.7 Locking and unlocking the keypad

To lock the keypad place your finger on the white dot located in the center of the horizontal scrolling bar between the **◀** - **▲** keys. Move your finger to the right following the dotted line and a window on the unit display will open with the message **Lock** (see figure 1.8). Continue moving your finger in the same direction until you enter blocked mode. The window on the display will close and the blocked keypad indicator will show on the top right of the unit screen.

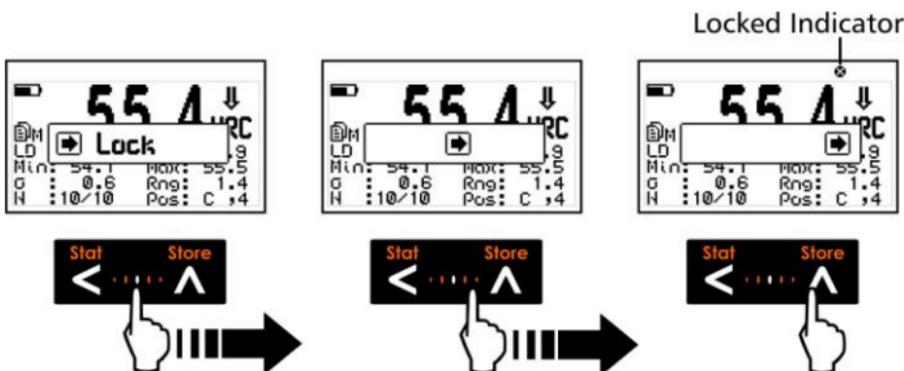


Figure 1.8: Locking the keypad

Sliding the finger to the left will unlock the keypad.

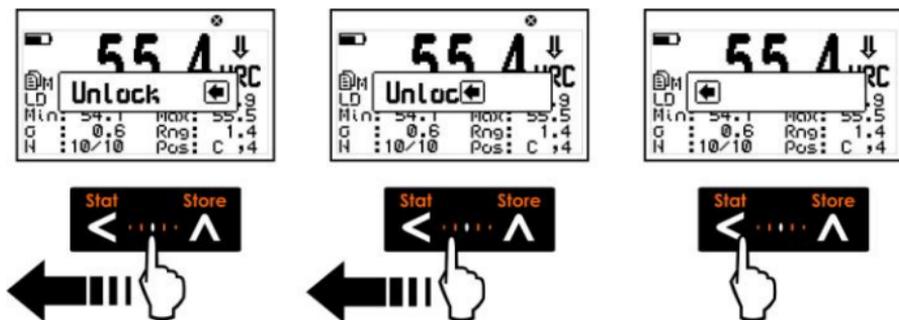


Figure 1.9: Unlocking the keypad



Important

The keypad can only be locked and unlocked in the measuring screens.

2 Measuring with the QH5

The QH5 can display measurements in 3 distinct numerical measuring modes or screens each one showing specific information. To switch numerical measure screens touch the  key.

2.1 Numerical measure screen (Normal)

2.1.1 Screen mode-1 (Datalogger)


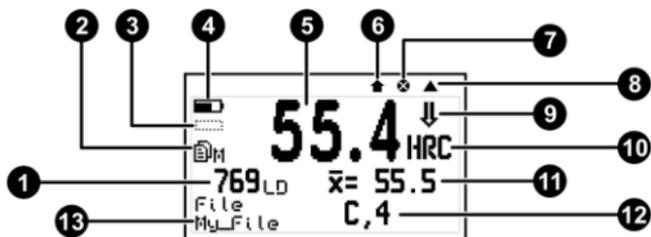


Figure 2.1: Measure screen mode-1

1. Leeb hardness value where L is Leeb and x is the impact device type
2. Datalogger mode indicator: X: Off - M: Manual - A: Auto
3. + (plus) or – (minus) measured value indicator as it relates to the nominal value in differential mode (*Page 37*)
4. Battery level indicator
5. Hardness value in the selected hardness unit
6. Icon indicating that a value was stored
7. Blocked keypad icon indicator (*Page 8*)
8. Impact device indicator

9. Impact device angle indicator (Page 16)
10. User selected hardness unit (Page 19)
11. Average hardness value in the hardness unit selected by the user
12. Position of the last stored value (Column, Row)
13. Name of the open file where values are being stored (Page 43)

2.1.2 Screen mode-2 (Material)

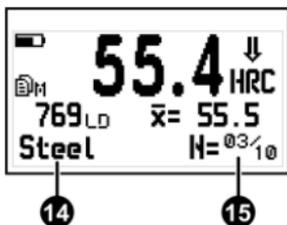

14. User selected test piece material (Page 17)
15. Number of (N) values indicator for real time statistics (Page 36)

Figure 2.2: Measure screen mode-2

2.1.3 Screen mode-3 (Statistics)

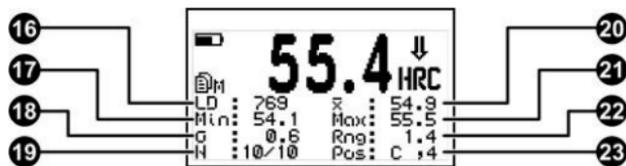


Figure 2.3: Measure screen mode-3

16. Leeb hardness value where L is Leeb and x is the impact device type

17. Minimum hardness value within the group
18. Average deviation within the group
19. Number of (N) values indicator for real time statistics (*Page 36*)
20. Average within the group
21. Maximum hardness value within the group
22. Range within the group
23. Location within the file of the last stored value

2.2 Keys in numerical measure modes

Keys in all three numerical measure screen modes have the following functions:



Stat : Touch to generate real time statistics based on the number of (N) stored values at the time this function is activated.



Store : Touch to manually store the measurement in the memory.



Graph : Touch to switch to the real time graphic histogram mode.



Home : Touch to exit the measure screen and enter the main menu.



Mem : Touch to view quick memory access options.




Edit : Touch to access the select / edit mode. 3 flashing arrows will appear over the fields of angle, hardness unit and material.



Figure 2.4: Measure screen in mode-2 select / edit mode

- To select angle touch (the angle can be changed even while measurements are being made).
- To select hardness unit touch .
- Touch to select material.

Always use the keys to edit the values in any given field and touch to save.

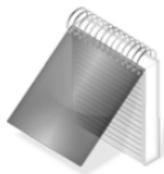

Notes

The material can only be changed in the numerical measure screen in mode-2 (Page 11).

The angle and hardness unit can be changed in any measure screen mode.

When the hardness unit is changed statistics, graphics and the actual hardness value on screen are set to zero.

 : Short touches allow you to switch between the three measure screen modes. Touch for 2 or more seconds to shutdown the unit.

 : Changes the backlight illumination.

 : Enters the direct access function established by the user.

 : Set display contrast.

 : Lock and unlock keypad.

2.3 Graphical measure screen (Histogram)

The QH5 allows you to view graphic representations of measured values in real time and in two screen modes.

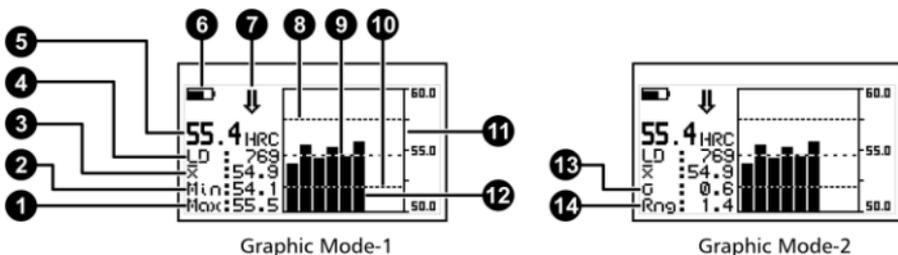


Figure 2.5: Graphical measure screens (mode-1 and mode-2)

1. Maximum hardness value within the group
2. Minimum hardness value within the group
3. Average within the group

4. Leeb hardness value where L is Leeb and x is the impact device type
5. Hardness value in the hardness unit selected by the user
6. Battery level indicator
7. Impact device angle indicator
8. High alarm indicator (*Page 23*)
9. Graphic of average value within group
10. Low alarm indicator (*Page 23*)
11. Graphic reference value representation in the selected hardness unit
12. Histogram bars that represent individual group values
13. Average deviation within the group
14. Range within the group

2.4 Keys in graphical measure modes

Key functions in the two graphic measure screen modes are the same as in the numerical measure screen modes (*Page 12*) except for the following keys:



: Go to the numerical measure screen mode



: Access the select / edit mode. Touch this key and 2 flashing arrows will appear over 2 fields namely angle and hardness unit.

- To select angle touch  (the angle can be changed even while measurements are being made)
- To select hardness unit touch 

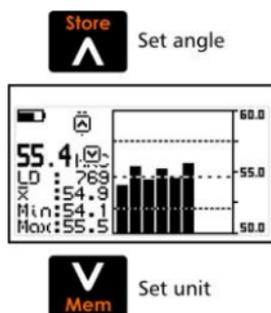


Figure 2.6: Graphic measure screen in select / edit mode

Use the to edit and to save the change in the hardness unit touch .

2.5 Set impact device angle

In rebound hardness testers that use a separate impact device, the angle in which the impact device is used, can affect the hardness value. In order to avoid erroneous measurements set the electronic unit to the same angle in which the impact device will be used.

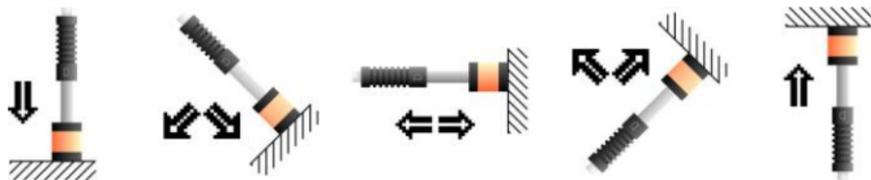


Figure 2.7: Icons corresponding to the impact device angles

The QH5 offers you three ways of changing the impact device angle:

- From the measuring screen touch  to enter the select / edit mode and touch  to select angle. Edit using   and touch  to save.
- Touching the  key as long it was set to Angle in the direct access options that can be set for this key (Page35).
- From the hardness configuration menu under Angle (Page 34).

2.6 Select material and hardness unit

Material and hardness unit options depend on the impact device that is connected to the unit.

Before measuring make sure that the impact device you will be using meets your needs in terms of the material, hardness unit, and hardness range in which you want to measure.

The QH5 offers you three ways to change the material:

- On the numerical screen in mode-2 only (Page 11) touch  to enter the select / edit mode and touch  to select the material. Edit using the cursor keys and touch  to save.
- Touching the  as long it was set to Material in the direct access options that can be set for this key (Page 35).
- From the main menu under Materials (Page35).

The QH5 offers three ways to change hardness unit:

- On the numerical measure screen touch  to enter the select / edit mode and touch  to select unit. Edit using the cursor keys and touch  to save.
- Touching the  as long it was set to Unit in the direct access options that can be set for this key (*Page 35*)
- From the main menu under Unit (*Page 22*)

For detailed information on all of the possibilities in terms of the materials, hardness units and hardness ranges in which you can measure, please refer to the tables in the Appendix "Tips on how to measure correctly" (*Page 56.*)

3 Menu system and editing

3.1 Instructions on using the menu system

The instructions explained in this chapter apply to all of the menus in the unit.

To scroll QH5 menu options use the   cursor keys. When you reach the end of the menu and move to the next menu option it becomes circular as shown herein.

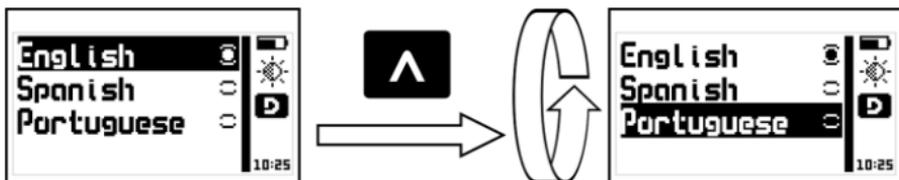


Figure 3.1: Example of how a circular menu works

To select a menu option touch  and to exit and return to the previous menu touch .

To go to the measuring screen touch  from the main menu, or touch  from any other menu in the unit.



Figure 3.2: Going to the measure screen

3.1.1 Text Editor

The text editor is used to input, modify and delete; letters, numbers and symbols.



Figure 3.3: Alphanumeric editor screens

1. Selected key
2. Cursor
3. Text to be edited
4. Virtual keyboard

Use the cursor keys on the unit to scroll the virtual keyboard until you find the character that you want to use and touch  to select.

Touch the  key to move to the upper case virtual keyboard and to the numbers and symbols keyboard as seen on figure 3.3.

There are 4 keys that are common to all virtual keyboard screens:

 


Figure 3.4: Common virtual keyboard keys

1. Move cursor to the left

2. Move cursor to the right
3. Delete character on which cursor is on
4. Enter and exit

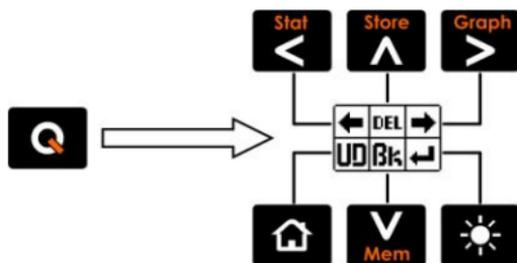


Figure 3.5: Quick access keys for the virtual keyboard editor

Touch the  key to open the direct access keyboard to the most commonly used virtual keyboard keys. Each virtual key corresponds to a key on the front panel of the unit as follows:

-  : Move the cursor to the left
-  : Erase the character on which the cursor sits
-  : Move the cursor to the right
-  : Undo
-  : Erase the character to the left of the cursor
-  : Enter and exit

To close the direct access keyboard and continue using the virtual keyboard touch .

3.2 Main menu




The main menu is the first list of options you will see when you exit the measure screen and it includes the most important settings. Touch  from the measuring screen to access this menu.

Figure 3.6: Main menu

3.2.1 Change hardness unit

Unit:

Touch  on **Unit** in the main menu to open the list of available hardness units.

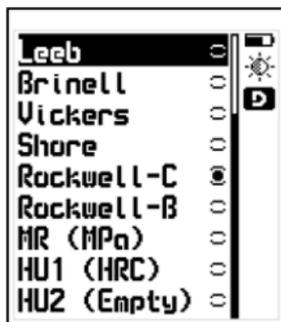


Use the   keys to scroll the menu.

Touch  to select the hardness unit.

Touch  to save and exit this menu.

Figure 3.7: Hardness unit options menu

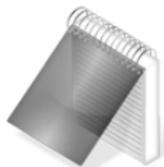

Notes

The units in (Figure 3.7) are for an impact device type D. Remember that hardness units depend on the impact device that is connected to the unit (Page 56).


Hardness units HU1 and HU2 are user units (Page 37).

3.2.2 Alarm Settings

Alarms

The QH5 has high and low alarm conditions that alert the operator when the measurement is greater than the value set for the high alarm and or when the measurement falls below the value set for the low alarm.

Touch  on **Alarms** to open the alarm menu options.

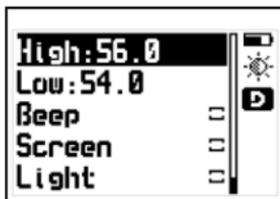

Touch  on **High** or **Low** to open the numbers editor where you can set alarm values using the cursor keys.

Touch  to save the alarm value that you entered and to return to the previous menu.

Figure 3.8: Alarm menu options

Alarm types that you can choose include:

Beep: Audible intermittent alarm type.


Screen: Visible alarm that causes measurements to be displayed in dotted instead of regular numbers.

Light: Visible alarm that activates the display backlight illumination causing it to flash.


3.2.3 Set histogram range

Histo Range

Here you can set high and low values (hardness range) that will be represented on the vertical axis of the graphical measure screen or histogram.

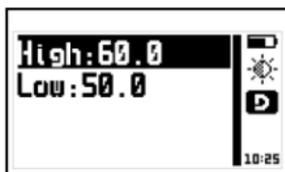

Set histogram range menu

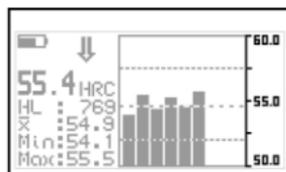

Range view in graphic mode

Figure 3.9: Set histogram range values

Touch  on **Histo Range** to open the histogram menu.

Touch  on **High** or **Low** to open the numbers editor where you can set values using the cursor keys and touch  to save the new value and return to the previous menu.

3.2.4 Select language

Language

Touch  on language (which is also identified with a flag) to view available language options.



Use the cursor keys to navigate available language options and touch  to select.

Touch  to save and exit this menu.

Figure 3.10: Language menu options


3.2.5 Unit information

Unit Info

Select **Unit Info** to view information including owner data as well as the software version that your unit is running.

To switch between unit information screens touch the **<** **>** keys.

To return to the main menu touch **🏠**.

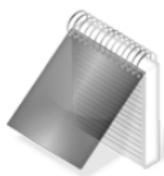


Note

The information required to obtain model upgrade licenses is included in this option.

3.3. General configuration options

Configure

Touch **↶** on the **Configure** option to open the general configuration options menu.

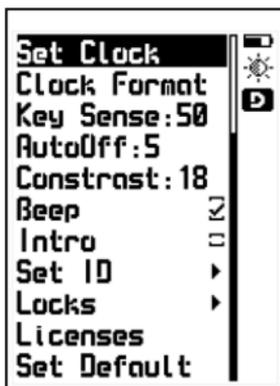

Use the **^** **v** keys to scroll the menu.

Touch **↶** to select any of the menu options.

Touch **🏠** to exit and to return to the previous menu.

Figure 3.11: General configuration options menu

3.3.1 Set time and date

Set Clock

Choose **Set Clock** to open the time editor and use the cursor keys to set the time. Touch  to save and to enter the date editor screen. After you change the date touch  to save and exit.

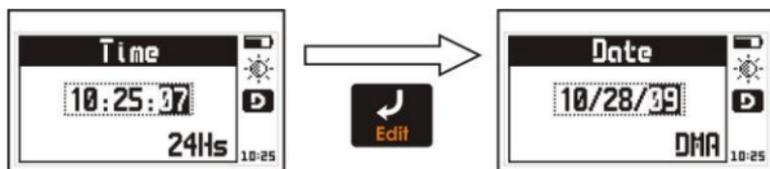


Figure 3.12: Time and date edit screens

3.3.2 Set time and date format

Clock Format

Choose **Clock Format** to open the menu that allows you to set the time format (12Hs or 24Hs) and the date format (D/M/Y – M/D/Y).



Touch  on the option you wish to select and touch  to save and exit.

Figure 3.13: Date and time format menu options

3.3.3 Set keypad sensitivity

Key Sense:

This option allows you to set the keypad sensitivity. The number that you set here has a direct relationship to the sensitivity of your keypad meaning that the higher the number, the more sensitive the keypad becomes.

Touch  on **Key Sens.** and use the - keys to change the keypad sensitivity. Touch  to save and the keypad will already be working with the new sensitivity level.

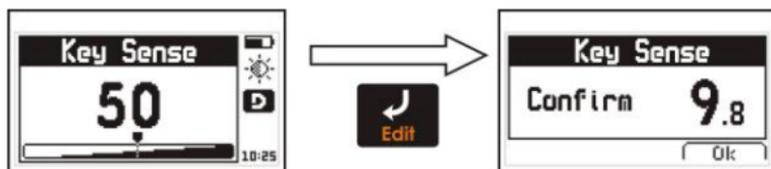


Figure 3.14: Key sensitivity setting and confirmation screens

To confirm the change in sensitivity touch . If you touch any other key or the on-screen counter reaches 0.0, the sensitivity will return to its previous setting.

The factory default setting is 50. Under special conditions we suggest that the sensitivity level be changed.



Tips

If the unit will be operated using security gloves we recommend that the sensitivity level be raised.

To make the keypad “harder” simply lower the sensitivity level.

In applications where the front of the unit may be exposed to water and or vapors the sensitivity should be lowered.

3.3.4 Set auto-off time

AutoOff:

The unit will shutdown automatically if no key is touched or no measurement is made after a time set by you.

Touch  on **AutoOff** to set the time before the unit automatically shuts down.



Touch the   keys to set the time and touch  to save and exit.

Touch  to exit without making changes.

Figure 3.15: AutoOff time setting screen

3.3.5 Adjust display contrast

Contrast:

Contrast settings allow you to turn your screen lighter or darker where 1 is the lightest and 32 is the darkest.

Touch  on **Contrast** and use the   keys to change the contrast on your screen.

Touch  to save or touch  to exit without making changes.

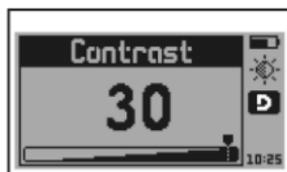


Figure 3.16: Screen contrast settings



Tips

Contrast on LCD screens can change with temperature. Use the contrast option to compensate for changes caused by temperature to maintain optimal viewing conditions.

3.3.6 Beep Activation

Beep

Beep refers to the sounds that the unit makes when keys are touched and when the audible alarm is active.

Touch  to enable or disable the beep option.

3.3.7 Introduction screen

Intro

The introduction screen is the first screen that you see after the unit is turned on and includes owner information such as name, telephone number and e-mail.

Touch  to enable or disable this option.

3.3.8 Owner information

Set ID

This option allows you to enter owner information (the info that would appear on the introduction screen).

Touch  on **Set ID**, enter the password (the factory default password is 12345) and touch  to access user info menu options.

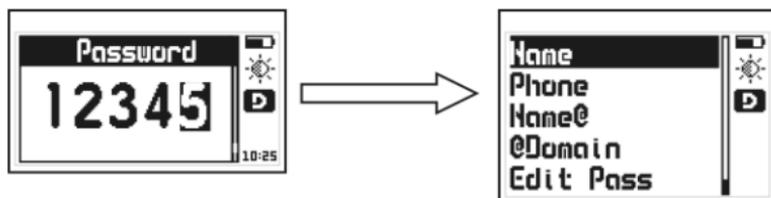


Figure 3.17: Enter password to access the user info menu

The user information that can be changed includes the following:


Name: Set or change the owner name.

Phone: Set or change the telephone number.

Name@: Set or change the e-mail (before the @).

@Domain: Set or change the domain for the e-mail (after the @).

Edit Pass: Allows you to change the password needed to access this menu.

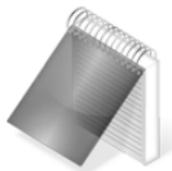

Notes

To set or change text see page 20.

When showing user information, the e-mail address is displayed as "Name@Domain".



Important

The factory default password is 12345. You can change this password after adding your user information.

3.3.9 Lock configurations

Locks

Certain configuration options on your QH5 unit can be locked in order to avoid unwanted changes. Use of the locking options allow a supervisor to optimize unit configuration settings required for a specific test and then pass the unit on to an operator for him or her to conduct the actual measurements knowing that the unit has been properly configured and that the settings cannot be changed.

Touch  on **Locks**, enter your password and then touch  again to view the configuration options that can be locked.

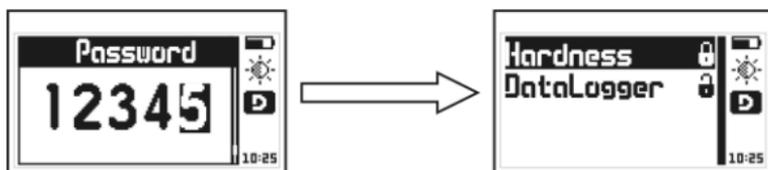


Figure 3.18: Enter password and options lock menu

Each option is followed by a lock indicating whether the feature is locked (closed lock) or unlocked (open lock).

Touch  on each of the following options to lock or unlock:

Configure: Lock or unlock hardness configuration options (Angle, Material, Hardness unit).

DataLogger: Lock or unlock Datalogger configuration options.

3.3.10 Model upgrade licenses

Licenses

QH5 models can be changed with software licenses that you can purchase from dmq. If you want to purchase an upgrade license we will need to know the following information:

- Unit model
- Unit serial number
- The type of license that you would like to purchase



Touch  on **Licenses** to view all licenses available for your unit (checkmarks indicate active licenses).

Figure 3.19: Licenses screen


To enter the new license number that you purchased touch  or to exit and return to the previous screen touch .



Use the cursor keys to enter the license number and touch  to save.

Figure 3.20: Enter license screen

After you enter the new license number the unit will respond with one of the following messages:

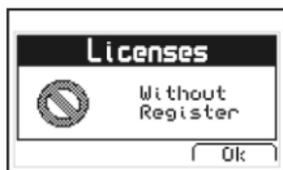

Wrong license password message



Correct license password message

Figure 3.21: Response messages after a license is entered

If the license number that you entered is correct the unit will show an updated license screen where the newly purchased license appears followed by a checkmark.

3.3.11 Return to factory default settings

Set Default

Choose **Set Default** to return to the original factory default general configuration options.

Touch  and a confirmation screen will appear.



Touch  to confirm and return to the previous menu or touch  to exit without making changes.

Figure 3.22: Set factory default settings confirmation screen

3.4 Measuring configuration options

Hardness



Select **Hardness** from the main menu to display measuring configuration options.


Correctly setting these options is critical in obtaining reliable hardness measurements.

Figure 3.23: Measuring configuration options menu

3.4.1 Set impact device angle

Angle:

Touch  on **Angle** to select the angle in which the impact device will be used.

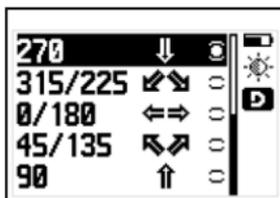

Use the   keys to scroll all menu options and touch  to select.

To exit without making changes touch .

Figure 3.24: Set Impact device angle menu

The angle you select here will also show on the measuring screen with the corresponding icon.

3.4.2 Select material

Material

Touch  on **Material** to select the material that corresponds to the test piece that you want to measure. The options available in this menu will depend on the impact device connected to the unit (Page 56).



Use the   keys to scroll all menu options and touch  to select.


To exit without making changes touch .

Figure 3.25: Materials menu

3.4.3 The “Plus” key



In the measuring screen the  is used to quickly access any of the options below as configured by you.

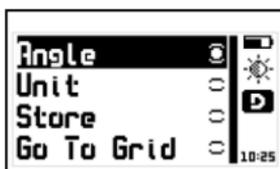

Touch  on  to open all quick access options.

Figure 3.26: Quick access options menu for the “Plus” key

Quick access options that can be set for the  key are:

Angle: To change the impact device angle.

Unit: To change the hardness unit.

Store: To manually store measurements using this key.

Go to Grid: Touch to go to the grid in the open file.

3.4.4 Set group (N) number


Group (N):

In order to obtain reliable measurements with your QH5, we recommend that you take at least 3 (three) measurements (within 3-4mm from one another) and use the average of all 3 values as your final hardness measurement. In order to make this a simple process, set an (N) number of values that will be used for averaging.

The (N) number is also used for statistical purposes and to set the number of columns in the Datalogger. Every (N) number of values all statistical data for any given group is automatically updated, and the group is closed in the Datalogger.

Partial statistics can be viewed at anytime by touching the  key.

Touch  on **Group (N)** to open the numbers editor where you can set the (N) number. Touch  to save and then touch  to exit.

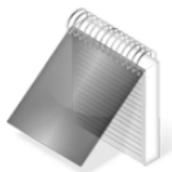

Note

Every time the hardness unit is changed, the group (N) number is automatically reset to zero and the group that was open in the Datalogger will be closed. A new group will be automatically opened.

To better understand how **Group (N)** works with the Datalogger refer to page 36 in this manual.

3.4.5 Select measure mode

Measure:

Touch  on Measure to open the measure modes options menu.

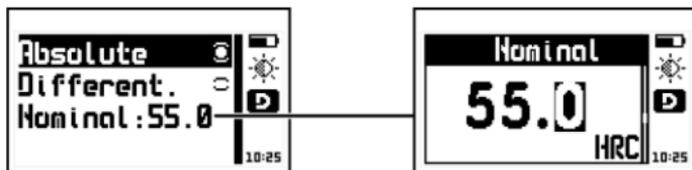


Figure 3.27: Measure mode options menu and set nominal value

The modes in which measurements are represented are:

Absolute: The unit displays the real measured value.

Differential: The value displayed is a result of the value obtained from calculating:

$$\text{Differential} = \text{Real value} - \text{Nominal value}$$


The nominal value is a reference value for the test piece. Touch  on **Nominal** to set this value and touch  to save. To exit without making any changes touch .

3.4.6 Create custom or user units

Custom Units

The QH5 allows you to create two customer or user units to measure uncommon materials that are not included in the predetermined list of materials in the unit as well as to measure special alloys. User units are defined on the basis of reference test piece samples of a known hardness values.

In order to create a user unit you must select a material (the closest one to a material in the predetermined list) that you will be measuring, and you must also choose a hardness unit.

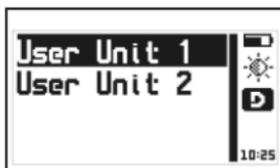

After selecting the material and hardness unit touch  on Custom Units to view available the User Unit 1 and User Unit 2 menu.

Figure 3.28: Select User Unit 1 or 2 menu

Choose one of the user units touching  (choosing user unit 1 or 2 makes no difference) and enter the first reference point:

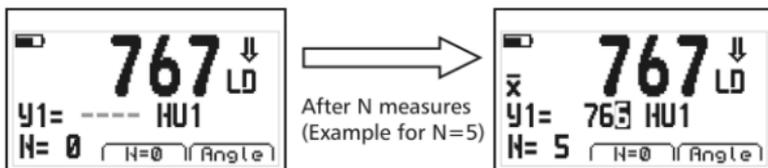


Figure 3.29: First user unit reference point

To enter the first user unit reference point you must make (N) number of measurements on the test piece of the uncommon material or alloy of a known hardness value.

Two options will appear on your unit screen:

N=0: Use the  key to reset the counter to 0 if a wrong measurement was taken.

Angle: Use the  key to change the impact device angle.

Each measurement will appear on the unit display with large numbers until the N number of samples is completed. When this happens an \bar{x}

symbol will appear indicating that the value on screen is the average of the N measurements. Right below the average value the number that appears after **Y1=** can be changed to match the known hardness value of the test piece sample.

When you touch  the new reference point will be saved and the menu will change giving you two new options:

Other: Touch  to add another reference point to the newly created unit.

Ready: Touch  to finish the process for creating a new user unit.

User units created with one reference point are precise for measurements that are close to the test piece sample hardness used to create the user unit in the first place.

In order to extend the measuring range for the newly created unit we recommend that another reference point be added using a second test piece sample of a known hardness value.

Touch  to add **Other**, another reference point, and the following screen will open:


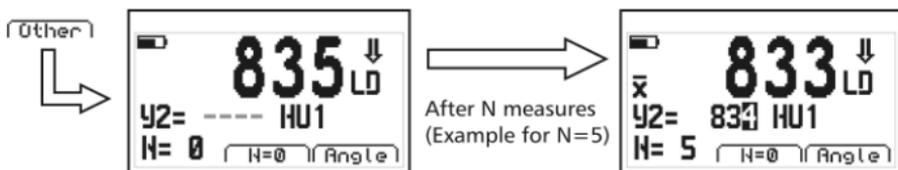


Figure 3.30: Second user unit reference point

To enter the second reference point, follow the same procedure that you used to enter the first one.

User units are called HU1 and HU2. In the hardness unit selection menu, newly created user units will be followed by the hardness unit that they were based on. So if for example HU1 was created using the Rockwell C (HRC) hardness unit, HU1 will be displayed as HU1 (HRC). Available user units are followed by (Empty).

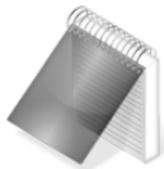

Notes

When a user unit is created using two reference points the first point must be of a lower hardness value than the second point or the operation will be automatically cancelled.

Even though a user unit has a different name (for example a user unit created using the Brinell (HB) hardness unit would be HU1 (HB)), measurements done with this user unit will display hardness values in (HB) only.

User units are only available for the material in which they were created. So for example if a user unit was created using steel, and you change to stainless steel, the user unit will be displayed as (Empty).

The (N) number of values used to generate reference points is set in Group (N) (Page 36).



Important

Because user units are created to measure uncommon materials and alloys they are approximate measurements that can present a greater degree of error when compared to the materials in the predetermined unit list. To know how precise a user unit really is you should work with several test piece samples of known hardness values that when measured should give you the approximate same error. This error now becomes a known factor.

3.4.7 Select impact device type

Device:

Touch  on **Device** to open the impact device options menu. The options displayed in this menu will depend on your QH5 model.

In order for you to better understand the relationship that exists between unit models, impact devices, materials, and hardness units as well as hardness ranges, please refer to page 56.



Use the   keys to scroll all menu options and touch  to select.

To exit without making changes touch .

Figure 3.31: Impact device menu options

When you select **Auto** the impact device type that is connected to the unit is automatically detected because of Cal-Tag technology available exclusively from dmq and that is included in all dmq impact devices. Generic impact devices can be used on dmq units but the impact

device type must be selected manually. When you do a manual selection make sure that the selected impact device corresponds to the impact device that is connected to the unit.

3.4.8 Set alarm for impact device tip **Tip Alarm**

The tip of the impact device is subject to wear that comes from regular use. This wear is progressive and can affect impact device accuracy. If you get erroneous hardness values the impact device tip is most likely worn or damaged and in need of replacement. For this reason we recommend that you check the tip using a known test block at least every 500 impacts to verify its condition. And in order to remind the operator, we included the **Tip Alarm** option that is activated when the automatic counter in the unit reaches the limit set by you.



Select **Every**: to set the alarm limit (default value is 500) and use **Reset** to set the counter back to zero each time the tip is replaced or the impact device is changed.

Figure 3.32: Set impact body counter alarm menu

3.4.9 Return to factory default settings **Set Default**

Choose **Set Default** to return to the original factory default hardness configuration settings.

Touch  and a confirmation screen will appear.



Touch  to confirm and return to the previous menu or touch  to exit without making changes.

Figure 3.33: Set factory default settings confirmation screen

4 Using the Datalogger

4.1 Understanding how data is organized

In order to optimize the use of the Datalogger in your QH5 it is important that you understand how data is organized.

In the QH5 data is stored in 8 individual files with alphanumeric names. Each file contains a grid with columns and rows. And each grid contains columns (identified with consecutive letters; A, B, ...AA, AB...) that store an "N" number of values or measurements (group). Each value is identified with a column letter and a row number.

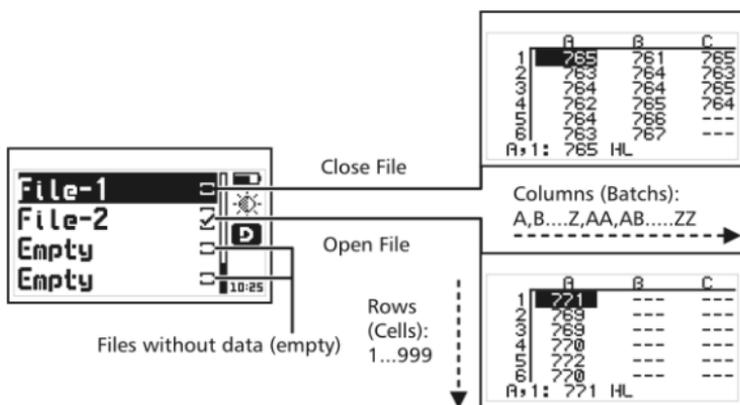


Figure 4.1: How data is organized in the Datalogger

In the above grid structure individual values are stored in a "Column (Batch), Row (Cell)". So for example C,4: 764 HL means this value is located in Column C and Row 4.

Column or Batch sizes can be set in the number of Group (N) values (Page 36) so that each time this "N" number is reached, a batch is closed and a new one is automatically opened. Every time the Group (N) number is changed, the number of values in each batch also changes without closing the file. This allows you to have different size batches within the same file.

4.2 Memory menu

Memory



Select **Memory** from the main menu to view all menu options for the Datalogger. This chapter explains how to create, organize, and view files.

Figure 4.2: Memory menu

4.3 Create a file

Touch  on **Files** and use the cursor keys to navigate the list of files in the unit.

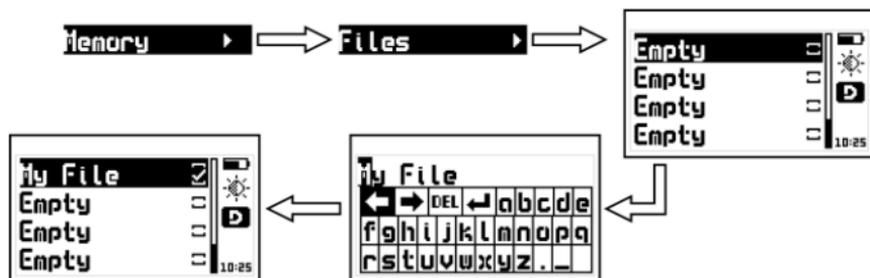


Figure 4.3: Creating a file

Select a file that appears as **Empty** (available file) and touch  to name the file with up to 10 alphanumeric characters.

After you enter a name a checkmark will appear next to it meaning that a new file has been created and is ready to be used.

Remember that only one file can be open at any given time so whenever a new file is created, if a file was already open, the file that was open will be closed. Once a file has been closed, it cannot be reopened and new values can no longer be stored. In closed files, values can only be viewed.

Whenever you create a new file, and another file is already open, a warning screen will ask if you want to close the last file.



Touch  to confirm that you want to close the open file to create (open) a new one or touch  to cancel and return to the menu.

Figure 4.4: Close file confirmation screen

4.4 Actions over single files

Touch  on any file that is not empty and a menu will open with all of the options of what you can do that file.



Figure 4.5: Individual file menu options

4.4.1 View data in a single file


View Data

	A	B	C
1	765	761	765
2	763	764	763
3	764	764	765
4	762	765	765
5	764	766	764
6	763	767	---
7	765 HL		---

Touch on **View Data** to view the contents of the file. Touch to exit the file.

Figure 4.6: File view in grid format

To move inside the grid use the cursor keys and touch to jump to the last column containing data.

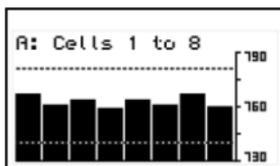

Touch on a value to open a histogram that includes that same value as well as the values included in the foregoing cells within that column.

Touch to exit and return to the grid.

Figure 4.7: Columns histogram

High and low hardness alarms appear in the histogram as dotted horizontal lines.

4.4.2 The Q key in a grid

Touch **Q** to open the quick access menu that allows you to go directly to a position inside the grid.

Select the **Row**, **Column**, and **Cell** using the **<** **^** **>** keys.

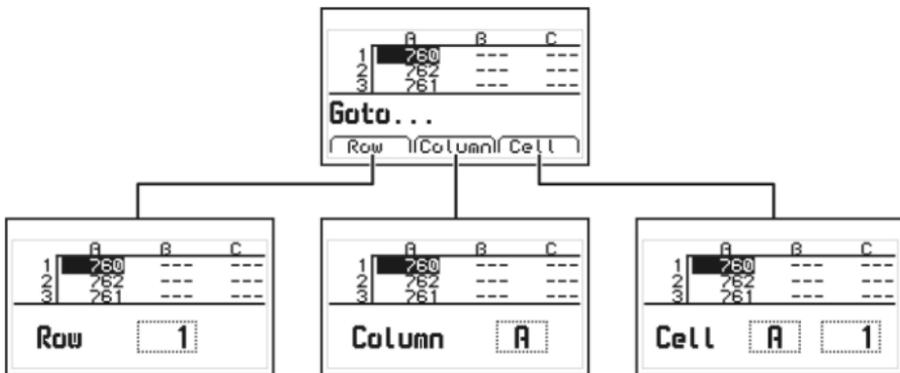


Figure 4.8: Quick access menu options in a grid

Row: Enter a row number using the cursor keys so that when you touch **↵** the grid will position itself directly on that row.

Column: Enter the column letter using the cursor keys so that when you touch **↵** the grid will position itself on that column.

Cell: This is a combination of (column and row) so that you can go to a specific cell after you enter the row number and column letter.

4.4.3 The Q key in a histogram

Touch **Q** in the histogram to open the quick access menu that allows you to obtain statistical information on the group of values being displayed.

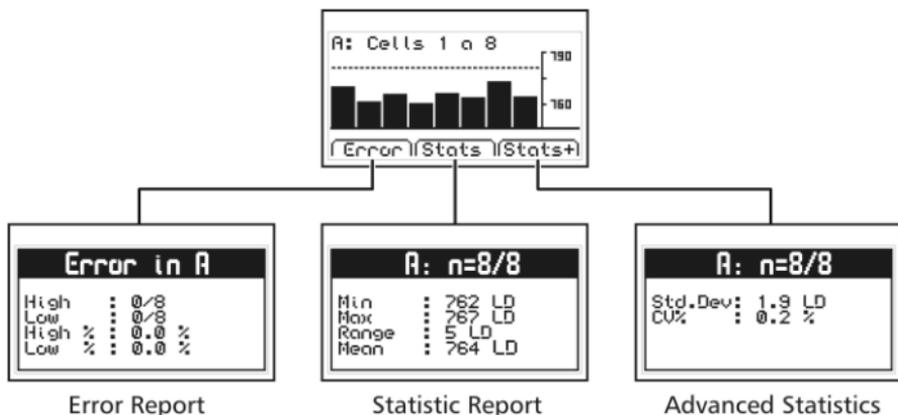


Figure 4.9: Quick access menu options in a histogram

Error: Displays the number of errors and error percentage values in the batch based on the high and low alarm settings.

Stats: View statistical information for the batch including Min., Max., Range and Mean values

Stats+: View the standard deviation and the percentage (coefficient variation) for the batch.

4.4.4 Send data from a single file

Send

Touch **↶** on **Send File** to send (units with Datalogger only) a single file to a PC using Windows HyperTerminal, or to a printer using an RS232 connection. This option does not work in USB mode.

4.4.5 Rename a file

Rename

Touch  on **Rename** to open the text editor that allows you to change the file name.

4.4.6 View file size

Size

Touch  on **Size** to view the number of stored values within a single file (and the size of the file as a percentage of total unit memory). You can also view the date and time in which the file was created.

4.5 Actions over all files

For all



Touch  on **For all** to open the menu for actions that will affect all files stored in the unit memory.

Figure 4.10: Actions over all files menu

4.3.1 Send all files

Send all

Touch  on **Send All** to send (units with Datalogger only) all files stored in the unit memory to a PC using Windows HyperTerminal, or to a printer using an RS232 connection. This option does not work in USB mode.

4.3.2 Erase all files

Erase all

The **Erase All** action permanently deletes all files stored in the unit memory and recovers 100% of the memory capacity.

Before files are deleted, a screen will be displayed asking you to confirm or to cancel this action.



Touch **>** to cancel and return to the previous menu or touch **<** to begin deleting all files.

Figure 4.11: Erase all confirmation screen

When the erase all action has been confirmed the following screens will be displayed:

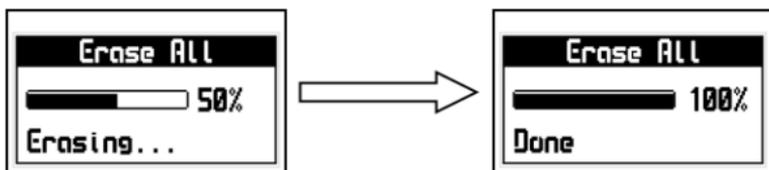


Figure 4.12: Erase all progress screen

4.6 Quick memory menu (Mem key)

Touch **V** on the measuring screen to open the quick memory menu.

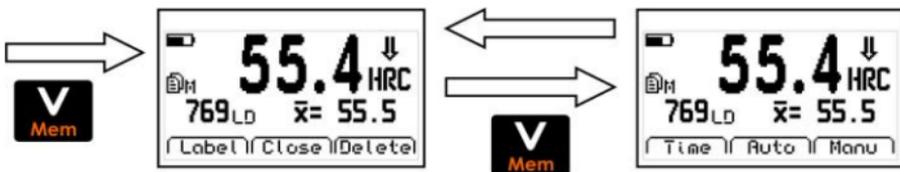


Figure 4.13: Quick memory menu options

In each quick memory menu screen three options are displayed. To access these options use the **<** **^** **>** keys. To change memory screens use the **V** key as seen on figure 4.13.

Options in the first quick access memory screen:

Label: Allows you to tag a value with a number from 0 to 65535 so that it can be easily identified in the grid that you open in DataCenter. Tags are not seen in the grids displayed in the unit.

Close: Close the current file and opens a new one.

Delete: Delete the last stored value.

Options in the second quick access memory screen:

Time: Inserts the time when the value was stored.

Auto: Activates the auto capture mode.

Manu: Activates the manual capture mode.

4.7 Connect to PC with DataCenter

Connect

Touch  on **Connect** to enter the “waiting to connect” mode.

Touch  to exit and cancel the connection.



Figure 4.14: Connecting to a PC


With the unit in “waiting to connect” make sure that the USB or the RS232 cable (depending on the type of connecting cable that you are using) is properly connected to both the unit and the PC and click on <Connect> in DataCenter.

When a successful connection is established the files in your unit memory will appear in DataCenter. To view their contents simply double click on each file.

For additional information on dmq DataCenter software refer to the manual included in the CD that you received with your QS5 or download the manual at <http://www.demeq.com/Download.html>

4.8 Datalogger Configuration

Configure

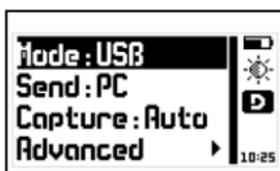

In the memory menu touch  on **Configure** to open the Datalogger configuration options menu.

Figure 4.15: Datalogger configuration options menu

4.8.1 Configure communications

The first two options in the configure Datalogger menu are **Mode** and **Send** which allow you to select how the unit will communicate with a PC or a printer.

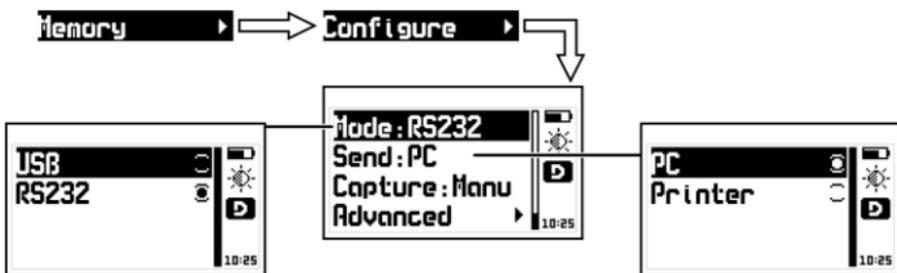


Figure 4.16: Configure communications options

Touch  on Mode to select the type of connection.

USB: Select USB to connect to a PC using a USB cable (included). You must already have DataCenter installed in your PC.

RS232: Select RS232 to connect to a PC or a printer using an RS232 cable (optional).

Touch  on Send to select whether you will send files to a PC or a printer.

PC: When using an RS232 cable, the unit sends data in an optimal format for Windows HyperTerminal (38400-8-N-1).

Print: Using an RS232 cable and printer, the unit sends data in an optimal format for mini-printers of 40 columns (9600/8-N-1).



Notes

The print option can only be used in RS232. Files cannot be directly sent to a USB printer.

When you use DataCenter to connect your selection of PC or print will not affect communication.

4.8.2 Capture modes

Capture:

Touch  on **Capture** to select the mode in which values will be stored in the Datalogger.



Figure 4.17: Memory capture modes menu

The QH5 has two modes in which to store values

Manual: Touch the  key to store values.

Auto: Every time a measurement is made, the value is automatically stored in the Datalogger. When this option is selected you can also store values when you touch the  key.

4.8.3 Advanced configuration

Advanced



Touch  on **Advanced** to access the advanced configuration options menu for the Datalogger.

Figure 4.18: Advanced configuration options menu

When you enable history the Datalogger will register the unit settings for each measurement that is stored. Information such as gain, trigger, velocity and calibration settings are stored along with the thickness value. This data can only be viewed in DataCenter. When history is enabled the unit memory capacity decreases as more data is stored.

Touch  on **History** to enable or disable this option and touch  to exit.

Touch  on **Clock** to set the time and date options that will be recorded by the Datalogger each time a new batch is opened. Touch   to scroll all menu options and touch  to select and exit. Touch  to exit without making changes.

Clock menu options include:

Off: The Datalogger does not record date and time.

Date: Each time a new batch is opened the Datalogger records the date.

Time: Each time a new batch is opened the Datalogger records the time.

Both: Each time a new batch is opened the Datalogger records the date and time.

Tips on how to measure correctly

When selecting the QH5 model that is right for you, you must first choose an impact device type. Select the impact device based on the materials, hardness units, and hardness ranges that you will be measuring by referring to the table below:

Hardness Ranges

Unit	Impact device type					
	D/DC	D+15	DL	C	G	E
Steel and cast steel						
HB	80 ~647	80 ~638	80 ~647	80 ~683	90 ~646	83 ~663
HV	80 ~940	80 ~937	80 ~940	80 ~996	—	84 ~1211
HRA	—	—	—	—	—	61 ~88
HRB	38 ~99	—	38 ~96	—	48 ~100	—
HRC	20 ~68	19 ~68	20 ~68	20 ~70	—	22 ~71
HS	32 ~99	33 ~99	—	32 ~100	—	36 ~103
MPa	275 ~ 2194	275 ~ 2180	275 ~ 2194	275 ~ 2194	305 ~ 2194	283 ~ 2195
Alloy tool steel						
HV	80 ~898	80 ~935	—	—	—	82 ~1009
HRC	20 ~67	20 ~68	—	—	—	22 ~70
Stainless steel						
HB	85 ~655	—	—	—	—	—
HV	85 ~802	—	—	—	—	—
HRB	46 ~101	—	—	—	—	—
HRC	20 ~62	—	—	—	—	—
Grey cast iron						
HB	93 ~334	—	—	—	92 ~326	—
Spheroid iron						
HB	131 ~ 387	—	—	—	127 ~ 364	—

Hardness Ranges (continued)

Unit	Impact device type					
	D/DC	D+15	DL	C	G	E
Cast aluminum						
HB	30~165	—	—	—	—	—
Brass						
HB	40 ~173	—	—	—	—	—
HRB	13 ~95	—	—	—	—	—
Bronze						
HB	60 ~290	—	—	—	—	—
Wrought copper						
HB	45 ~315	—	—	—	—	—

The QH5 D only works with impact device types D and DC.

The QH5 G only works with impact device type G.

The QH5 M works with all impact devices.

Do not measure over an indentation caused by a previous measurement.

The surface you are measuring must be clean and dry.

The minimum surface roughness requirements needed to obtain precise measurements are:

	Impact device type					
	D/DC	D+15	DL	C	G	E
Surface condition (roughness)						
Rugosity	N7	N7	N7	N5	N9	N7
Rugos. RT (μm)	10	10	10	2,5	30	10
Rugos. RA (μm)	2	2	2	0,4	7	2

Do not measure test pieces that exceed the maximum hardness limits of your impact device:

Impact device type	Maximum hardness
D – DC – DL – E	890 HL (68 HRC)
C	960 HL (70 HRC)
G	750 HL (645 HB)

To obtain precise measurements the following minimum mass and thickness requirements must be met:

	Impact device type					
	D/DC	D+15	DL	C	G	E
Minimum test piece weight (kg / pounds)						
Stand alone	5/11	5/11	5/11	1.5/4.9	15/33	5/11
With support	2/4.4	2/4.4	2/4.4	0.5/1.1	5/11	2/4.4
Coupled	0.1/0.22	0.1/0.22	0.1/0.22	0.02/0.04	0.5/1.1	0.1/0.22
Minimum test piece thickness (mm / inch)						
Coupled	3/6.6	3/6.6	3/6.6	1/2.2	10/22	3/6.6
Superficial	0.8/1.76	0.8/1.76	0.8/1.76	0.2/0.44	—	0.8/1.76

When working with a portable hardness tester you should always average at least 3 measurements (the QH5 does real time statistics) and the measurements must be made at no more than 4mm from one another. The results of these measurements should do not differ in more than ± 6 HLD units. If a difference of ± 6 HLD units is obtained check test conditions and measure again.

When measuring on curved surfaces the curvature radius should not go above 0.3mm in both concave and convex angles. Always use supporting rings on non-flat surfaces.

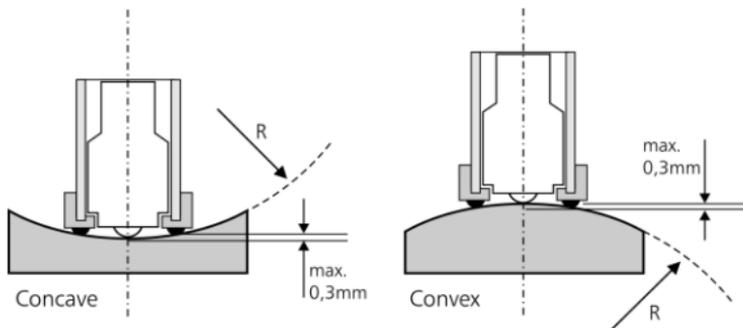


Figure A.1: Measuring on curved surfaces

Control your impact device on a reference test block at least every 500 impacts to check its condition.

Always make sure that the unit has been correctly configured for material, impact device type and impact device angle.

Do not use lubricants or grease in the mechanical parts of your impact device. The impact device is cleaned using the brush included with the unit.

Technical Specifications

Measuring Principle	Impact Leeb Rebound
QH5 D Impact Devices	D, DC
QH5 G Impact Device	G
QH5 M Impact Devices	D, DC, DL, D+15, E, G, C
Materials	Steel and cast steel, Alloy tool steel, Stainless steel, Grey cast iron, Spheroid iron, Cast aluminum, Brass, Bronze, Wrought Copper.
Impact Angles	All directions. (manual selection)
Hardness Units	Leeb, Brinell, Vickers, Shore, Rockwell A, B and C.
Resolution (Entire Hardness Range)	Leeb : 1 HL Brinell : 1 HB Vickers : 1 HV Shore : 0,1 HS Rockwell : 0,1 HRA / B / C
Measuring Range	150 HL to 990 HL
Precision	$\pm 0,5\%$ @ 800 HLD (± 4 HLD)
Real Time Statistics	Maximum, Minimum, Medium, Range and Standard Deviation.
Alarms	High and Low. Visible and Audible.
Languages	English, Spanish and Portuguese.
Datalogger	Up to 32500 values in 8 files. Manual and Auto capture modes. Files with alphanumeric names. Date and time registry. Viewable in grids and graphics with real time statistics.

Connect to PC	USB or RS232
Display	Graphical 128 x 64 pixels with digital contrast and backlight. 24mm digits.
Keypad	Touch-Sense keypad with no mechanical parts and sensitivity adjustment.
Battery Life	150 Hr with 2 AA type batteries.
Working Temperature	-10°C to +50°C
Enclosure Size	ABS 78x117x24 mm with rubber sides.
Weight	200g with batteries.

Additional information

To become a part of the dmq family of users and to receive newsletters and promotional offers available only to dmq customers, register your unit at www.demeg.com/form_Register.html

Unit maintenance

The QH5 was developed and manufactured for years of trouble free operation and even though the unit does not require special care the following precautions should be considered:

- Avoid contact with corrosive and abrasive substances.
- Do not clean the unit with solvents.
- Do not leave the unit display exposed to direct solar light for prolonged periods of time as this could damage the display.
- Remove the batteries if the unit will be stored for an extended period of time.
- Remove the impact device using the connector and not the cable.
- Do not twist or strangle the impact device cable.
- Do not expose the unit to temperatures below -10°C / 14°F or above 50°C / 122°F .

QH5 Accessories

dmq Part No.	Description
QHM 300	Small high impact carrying case
QHM 520	Large high impact carrying case
QHS 101	Type D impact device with Cal-Tag
QHS 201	Type DC impact device with Cal-Tag
QHS 301	Type DL impact device with Cal-Tag
QHS 501	Type C impact device with Cal-Tag
QHS 601	Type G impact device with Cal-Tag
QHP 001	Test block HLD
QHP 101	Certified HLD test block
QHP 002	Test block HLG
QHP 102	Certified HLG test block
QHA 012	Set of support rings (12 each)
QHG 001	Coupling paste (small)
QHG 002	Coupling paste (large)
QHL 103	QH5 D to QH5 M upgrade license
QHL 203	QH5 G to QH5 M upgrade license
QAC 002	RS232 cable to connect to a PC
QAC 003	RS232 cable to connect to a printer

For additional information and accessories for your QH5 visit www.demeq.com/Accessories-QH.html

Error messages

Error messages may eventually open on your unit screen and are informational only.

If one of these messages opens on your display follow the instructions described below and if the problem persists please send us a detailed report at www.demeq.com/form_Support.html



Figure A.2: System error message

Error 1	Internal Error
Cause	Internal Error
Solutions	Shutdown the unit, wait a few seconds, and power back on. Contact demq.

Error 2	Attempt to store a value over an existing value.
Cause	Improper unit shutdown (Example: Removing batteries) and powering the unit back on to store values in the Datalogger.
Solution	Download Datalogger values to PC or printer and erase memory.

If a message with a different number were to appear please contact demq.

Our website: www.demeq.com

Our website is a powerful customer support tool where you will find the latest information as it relates to your QH5 including:

- Application notes
- Manuals and brochures
- Firmware and software updates
- Model upgrade license information
- New accessories

Firmware and software updates

To download firmware and software updates to your QH5 you must have dmq DataCenter installed on your PC.. To download the latest updates for your unit refer to www.demeq.com/Download.html

Technical support

Our service department is committed to providing prompt and courteous service. Should you encounter any trouble with your QH5 please send us a detailed description of your problem to www.demeq.com/form_Support.html

