


Order Code	Description
✓ DPMD1	PosiTector Standard with DPM D Probe
DPMD3	PosiTector Advanced with DPM D Probe

PosiTector DPM Dew Point Meter	Compare PosiTector Gage Bodies	
Features	Standard	Advanced
<b>NEW</b> Larger 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation	•	•
Auto Log mode runs unattended on batteries for up to 50 hours or continuously via USB	•	
Enhanced Auto Log mode turns the gage off between readings for up to 8 months of battery life. Each reading can be uploaded to PosiSoft.net or an FTP server using WiFi. Automatically group readings into batches at daily, weekly, or monthly intervals.		•
Two year warranty on body AND probe	•	•
User defined limits for all parameters—visible and audible warnings. Send email alerts when connected to WiFi.		•
Reading Storage Capacity	2,500 datasets	250,000 datasets in up to 1,000 batches
<b>NEW</b> Touchscreen keyboard for quickly renaming batches, adding notes, and more		•
Store thickness, profile, environmental, salt contamination, hardness, and wall thickness measurements in individual batches		•
Wet bulb temperature can be displayed and recorded		•
Trend Charts graph readings in real-time		•
Connection Options		
USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.	•	•
WiFi technology wirelessly synchronizes with PosiSoft.net and downloads software updates		•
Bluetooth 4.0 Technology for data transfer to a mobile device running the PosiTector App or optional portable printer. BLE API available for integration into third-party software.		•



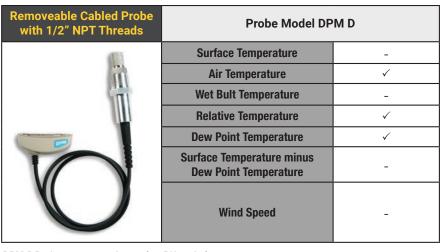

DPM D Probe measures dew point, RH and air temperature.

- 1/2" NPT threads for insertion into tanks and pipes (max 1.3 MPa/200 psi)
- Sintered aluminum housing protects sensors

©DeFelsko Corporation USA 2021. All Rights Reserved. Technical Data subject to change without notice. • PDPM.v.LW/W2101







Order Code	Description
✓ DPMD1	PosiTector Standard with DPM D Probe
DPMD3	PosiTector Advanced with DPM D Probe

#### All Gages Feature...



- All readings are constantly updated and displayed simultaneously
- No need to consult complex tables or use a slide rule calculator
- Alarms indicate when climate conditions are unsuitable for painting
- NEW Larger 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation
- NEW On-gage help explains menu items at the touch of a button
- · RESET feature instantly restores factory settings



- **NEW** Weatherproof, dustproof, and water-resistant—IP65-rated enclosure
- NEW Ergonomic design with durable rubberized grip
- Shock-absorbing protective rubber holster for added impact resistance
- Two year warranty on gage body AND probe



- · Fast response precision sensors provide accurate, repeatable readings
- SmartTrend™ Indicators identify rising, falling, or stable readings
- Certificate of Calibration showing traceability to NIST included (Long Form)
- . Conforms to national and international standards including ISO and ASTM

### rable established



- Hold function freezes the display allowing measurements to be manually recorded
- Screen Capture—save 100 screen images for record keeping and review
- . NEW Instant-on feature quickly powers up the gage if recently powered down
- NEW Up to 30% longer battery life
- USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- · Software updates via web keep your gage current
- Every stored measurement is date and time stamped
- Includes PosiSoft suite of software for viewing and reporting data (see page 3)

Specifications	Range	Accuracy	Resolution
Surface Temperature	–40° to 80° C	± 0.5° C	0.1° C
	80° to 190° C	± 1.5° C	
	–40° to 175° F	± 1° F	0.1° F
	175° to 375° F	± 3° F	
Air Temperature	–40° to 80° C	± 0.5° C	0.1° C
	–40° to 175° F	± 1° F	0.1° F
Humidity	0 to 100%	± 3%	0.1%
Dew Point	–60° to 80°C	± 3° C*	0.1° C
	–76° to 175° F	± 5.4° F*	0.1° F

\*Dependent on RH. See www.defelsko.com/TdAccuracy for more information.



- Auto Log mode records environmental parameters at user selected time intervals
- · Celsius/Fahrenheit switchable
- · Selectable display languages
- NEW Auto rotating display with Flip Lock





Comes complete with PosiTector gage body, DPM probe, environmental sensors, protective rubber holster, wrist strap, 3 AAA batteries, instructions, nylon carrying case with shoulder strap (DPM/DPMA/DPMD), hard shell carrying case (DPMS), protective lens shield, Long Form Certificate of Calibration traceable to NIST, USB cable, two (2) year warranty.

\*SIZE: 127 x 66 x 25.4 mm (5" x 2.6" x 1")

\*WEIGHT: 137 g (4.9 oz.) without batteries

**CONFORMS TO:** ISO 8502-4, BS 7079-B4, ASTM D3276, IMO PSPC, SSPC-PA7, and US Navy NSI 009-32 \*Size and weight are for the PosiTector gage body only and do not include the probe.

©DeFelsko Corporation USA 2021. All Rights Reserved. Technical Data subject to change without notice. • PDPM.v.LW/W2101





### **PosiSoft** Suite of Software

**ABC** 

Powerful ways to view and report your PosiTector and PosiTest data


#### **PosiSoft Desktop** — PC/Mac

Powerful desktop software for downloading, archiving, and reporting measurement data.

- Import readings directly from the gage via USB, WiFi, or legacy PosiSoft Desktop versions
- Jobs feature consolidates batches into groups to keep measurement data organized and to quickly create multi-batch reports
- Fully integrates with PosiSoft.net—
   backup and synchronize jobs, batches, readings, and report templates to the
   cloud (see inset at right)
- Export readings as .csv (comma separated value) files for easy import into Excel and other spreadsheets

#### Professional, Custom Reports

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more with an onscreen live preview
- Instantly create professional reports from pre-formatted report templates
- Design custom layouts and templates—add custom cover pages and logos, and choose to display charts, histograms, and/or individual readings
- Drag-and-drop Custom Fields mode—import PDF forms and overlay fields to automatically populate inspection data

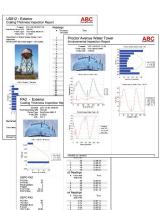


# State Internal Control of Control

#### **Prompted Batch Mode**

Create pre-defined batches with onscreen text and image prompts for each reading and upload to PosiTector 6000, 200, and UTG gages (*Advanced models only*).

 Ideal for ensuring a consistent measurement pattern for repetitive jobs or when specific measurement locations are required

#### PosiSoft USB Drive — Gage based



A simple gage interface to retrieve data in a manner similar to USB flash drives or cameras. No software to install or internet connection required. Measurement data can be printed quickly from a formatted HTML report or exported in .csv format for further analysis in spreadsheets.

#### **PosiTector App** — iOS/Android

Fully-featured mobile app that connects to the PosiTector SmartLink, PosiTector Advanced gages, and the PosiTest AT-A.

- Auto pairing Bluetooth BLE connection
- Add images and notes to individual readings or batches directly from your device
- Email readings as .csv (comma separated value) files for easy import to Excel and other spreadsheets.
- Synchronize readings with PosiSoft.net backup and synchronize jobs, batches, and readings to the cloud (see inset below)

## Done Batch Report USB 812 Ogdensburg, NY Interest to the process of the proces

#### **Mobile Reporting Solution**

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more
- Email pre-formatted or custom reports from your device instantly



#### PosiSoft.net

Secure storage of measurement data in the cloud.

compatible with PosiSoft Desktop and PosiTector App

- Upload measurement data directly from WiFi-connected PosiTector Advanced gages from anywhere in the world—no software required
- Synchronize and share measurement data across multiple computers

#### Ideal for...

- Users with multiple computers, instruments, and office locations
- Inspection companies managing data from multiple inspectors
- Login from PosiSoft Desktop to synchronize all measurement data and stored report templates from your account



**PosiSoft.net Web Viewer** Review measurement data and print simple, pre-formatted PDF reports from any web browser—no software installation required.

#### PosiTector Developer Resources

Bluetooth 4.0

WiFi

•Keyboard Mode

•USB Serial

PosiTector and PosiTest AT-A instruments can integrate with third-party software, drones, ROVs, PLCs, and robotic devices using several industry-standard communication protocols including: Bluetooth 4.0, WiFi, Keyboard mode, and USB serial.





